

也无异响；
动机前端曲
啦咔啦”的

端的传动带，切断空调压缩机的动力，用于旋转空调压缩机传动轴，没有听到异响。考虑到接通空调增加了发动机负荷，推断异响可能与发动机负荷的增加有关。增加发动机负荷的方法除了接通空调系统，还有接通前照灯，转动方向盘，踩住制动踏板并挂前进挡或倒挡等方法。为了使异响明显，决定采用能使发动机负荷增加较大的方法，即踩住制动踏板并挂前进挡。

汽车听诊器
异响；缓性
否则就成了
大问题。

发动机内部曲轴传动轮附近的主要机构为发动机正时链条传动机构和机油泵链条传动机构（见下面二图）。发动机正时链条传动机构主要由曲轴链轮、凸轮轴链轮、正时链条、链条导板、链条张紧装置等部件组成，这些部件安装在曲轴及曲轴以上的发动机气缸体及气缸盖上。机油泵链条传动机构主要由曲轴链轮、机油泵链轮、机油泵链条、链条导板、链条张紧装置等部件组成，这些部件安装在曲轴及曲轴以下的发动机气缸体及机油泵壳上。其中，曲轴链轮为主动部件，凸轮轴链轮和机油泵链轮为从动部件，正时链条和机油泵链条为传动部件，链条导板和链条张紧装置的作用是减小链条的振幅及传动噪音，以保证链条传动平稳。由此推断，发动机正时链条传动机构或机油泵链条传动机构的链条导板或链条张紧装置损坏。与驾驶人沟通得知，该车发动机正时链条传动机构已在行驶里程达 20 万 km 时更换过，进一步推断机油泵链条传动机构的链条导板或链条张紧装置损坏的可能性较大，于是决定先拆检机油泵链条传动机构。拆下油底壳，发现机油泵链条导板掉在了油底壳中，进一步检查发现，机油泵链条张紧装置上的动臂已损坏脱落，失去了张紧作用，导致机油泵链条搭落在链条张紧装置的固定架上。

第 1 页 共 4 页

This exploded view diagram illustrates the components of the timing chain assembly for the cylinder head. The diagram shows the cylinder head assembly on the left and the timing chain components on the right. Labels in Chinese point to specific parts:

- 凸轮轴链轮 (Camshaft sprocket)
- 曲轴链轮 (Crankshaft sprocket)
- 正时链条 (Timing chain)
- 正时链导板 A (Timing chain guide plate A)
- 正时链导板 B (Timing chain guide plate B)

The diagram provides a clear visual reference for the placement and orientation of each component during assembly.

