

## Porsche 911 spoiler calibration

Function Description: 2017 Porsche 911 spoiler calibration

Supported products: Launch all series integrated diagnostic device

Tested model: 2017 Porsche 911



Spoiler cannot be stowed after dismantle for service




When depressed spoiler panel button, the button light is flickering, but spoiler cannot be stowed




## Operation procedure:


1. Use 431 PAD 5 to enter Porsche diagnostic software, select [Rear-end Electronics], click [Read Fault Code];

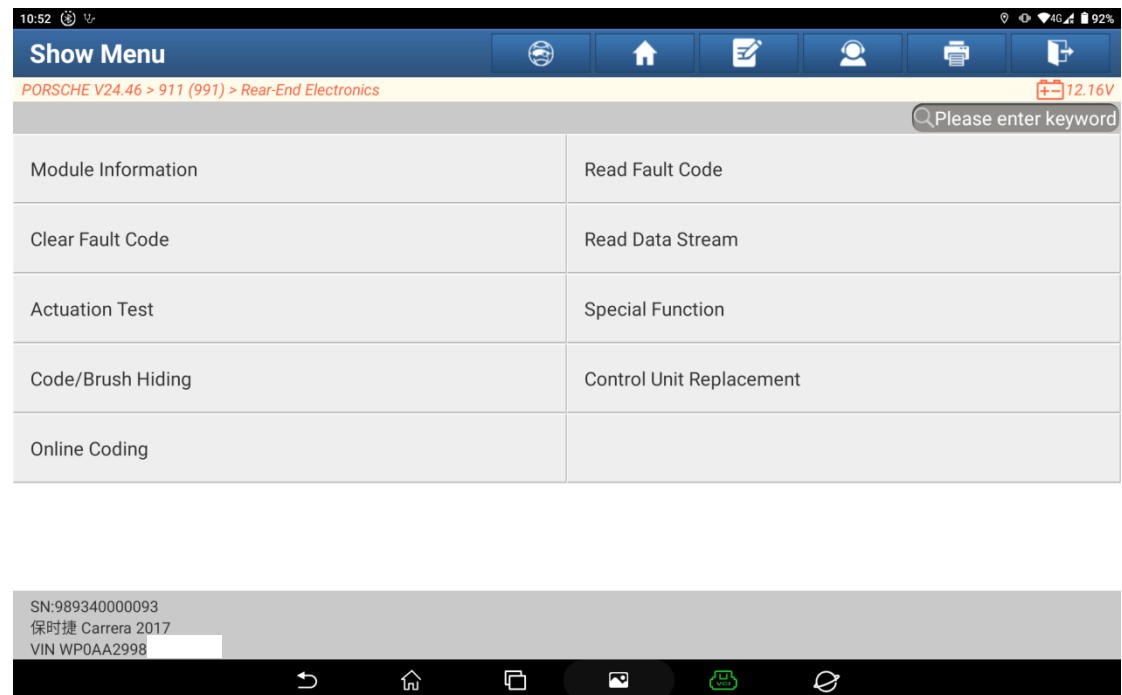


2. It read a [C1007 calibration] fault code, fault code status is [Active], the fault code cannot be deleted, please calibrate spoiler first

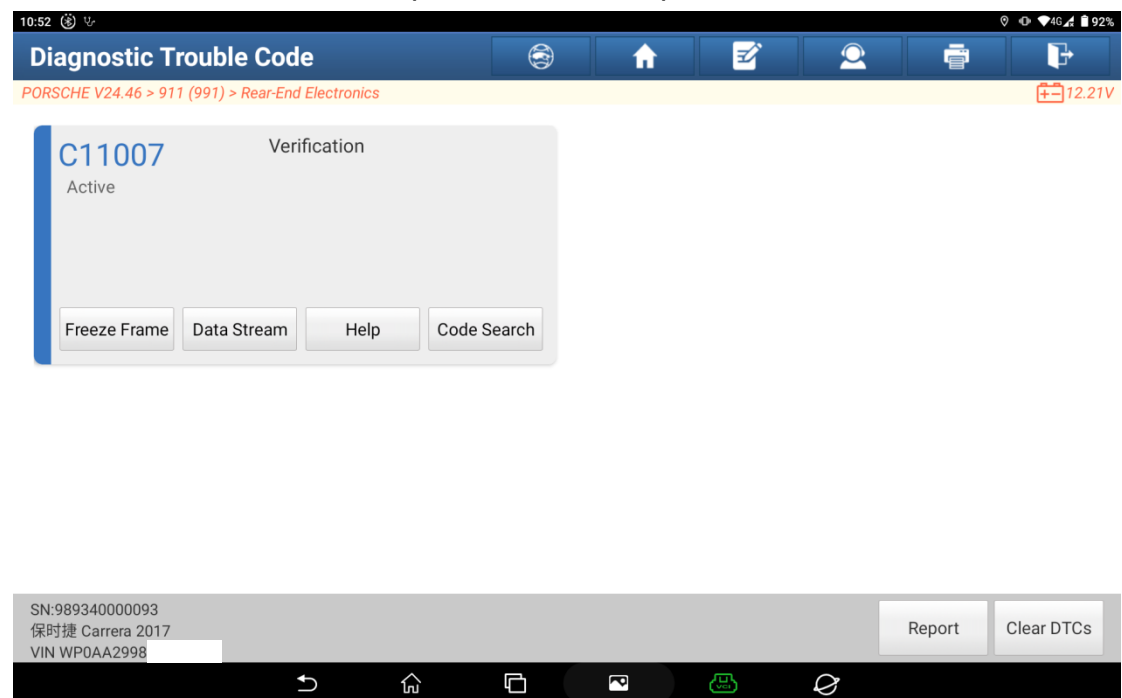


## 3. Click [Actuation Test];

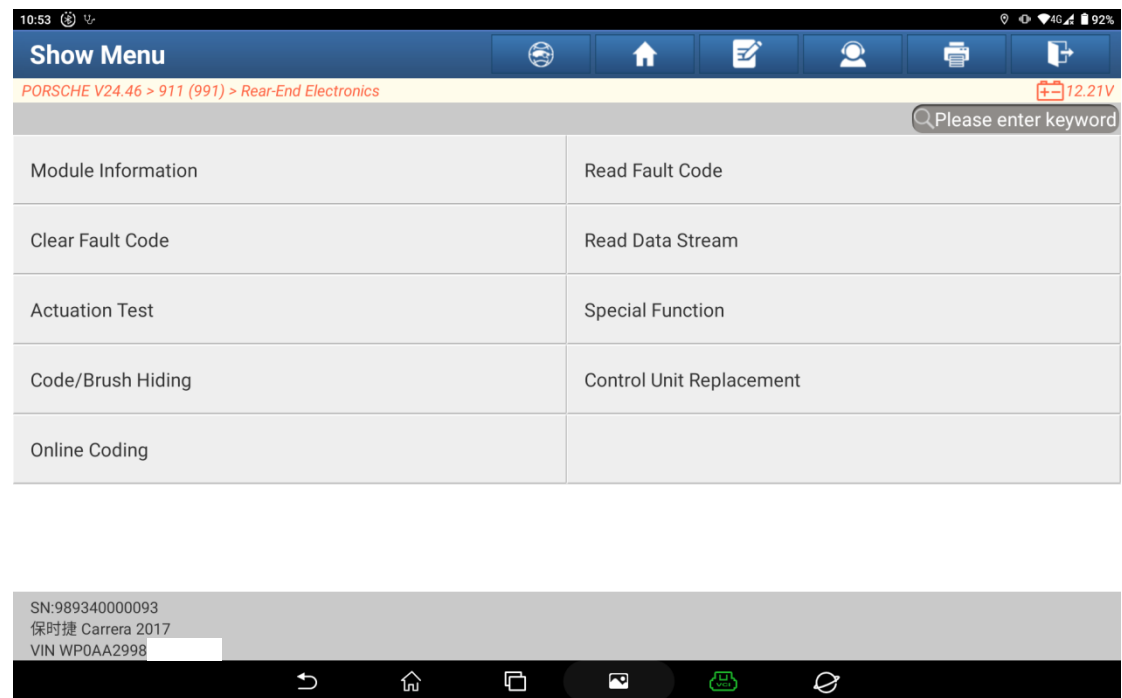


## 4. Click [Setup];

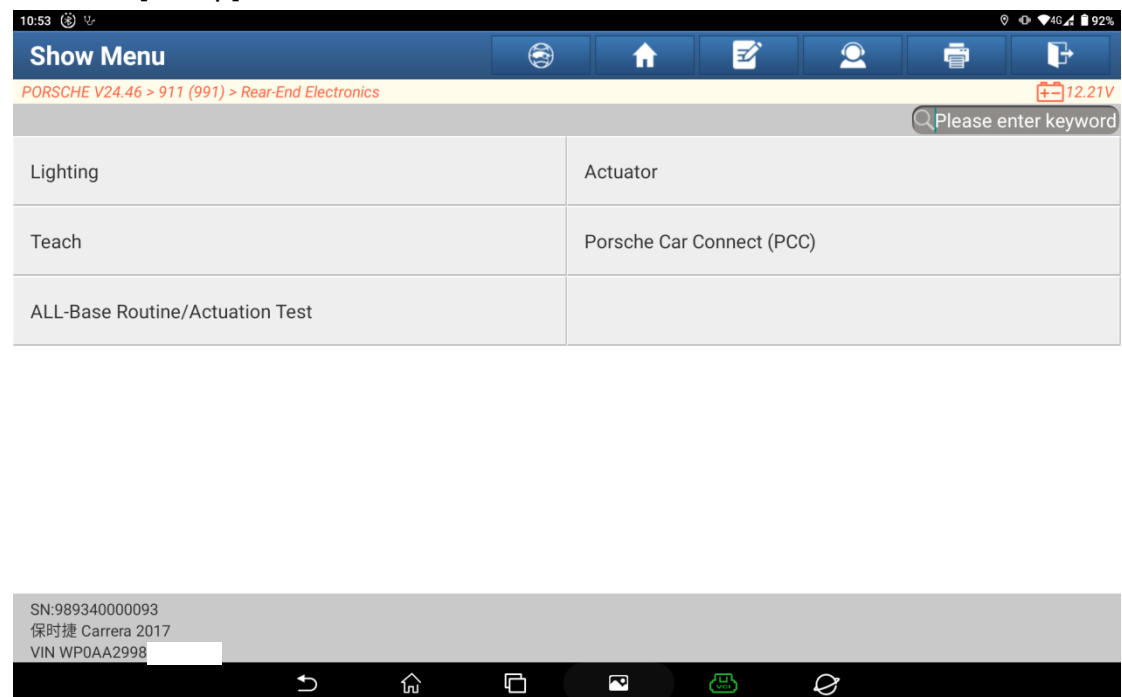

5. Click [Spoiler normalizing run];

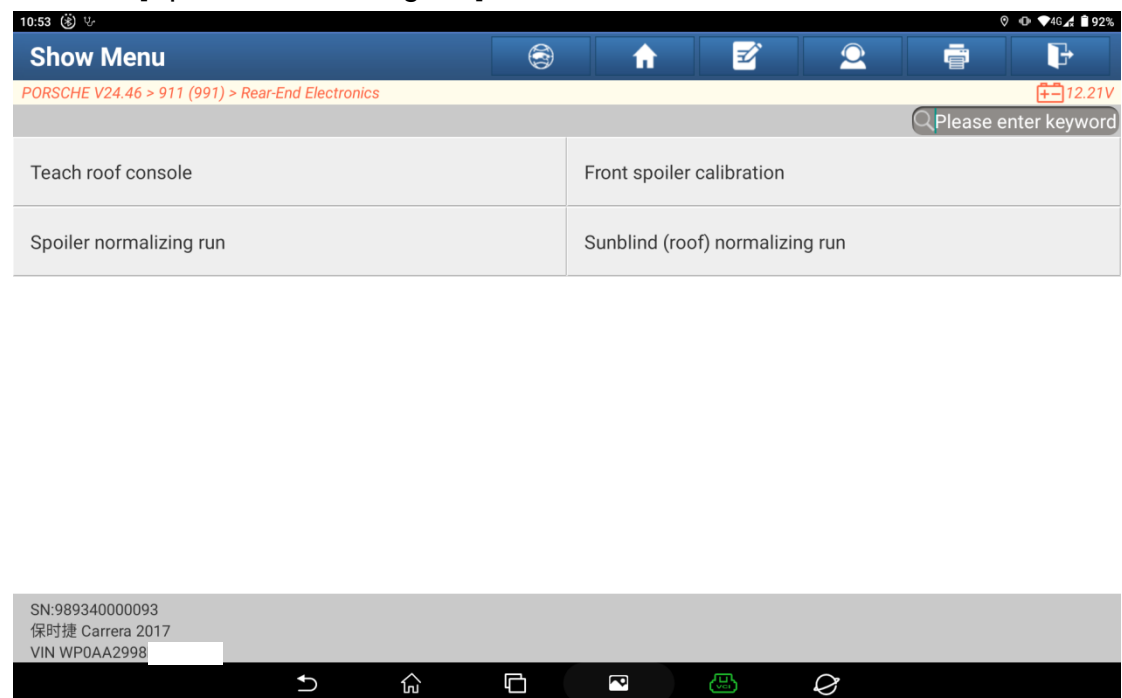

6. Click [Actuated];

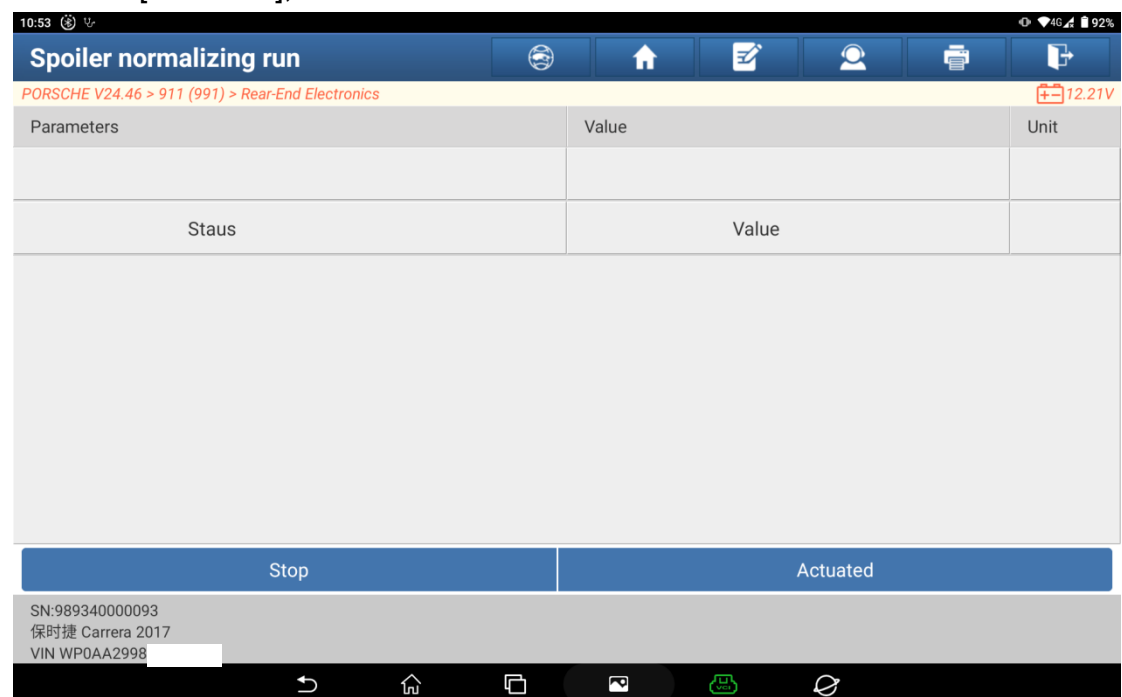

7. Actuation test status is [Function completed], spoiler calibration succeeded;

10:54


 92%

**Spoiler normalizing run**

Porsche V24.46 > 911 (991) > Rear-End Electronics

12.21V

Parameters	Value	Unit
Staus	Value	
status	Function Completed	

Stop

Actuated

SN:98934000093  
保时捷 Carrera 2017  
VIN WP0AA2998

8. Read the fault code again, the fault code status is [Inactive], fault code can be cleared;

10:54


 92%

**Diagnostic Trouble Code**

Porsche V24.46 > 911 (991) > Rear-End Electronics

12.21V

C11007
Verification

Inactive

Freeze Frame

Data Stream

Help


Code Search

SN:98934000093  
保时捷 Carrera 2017  
VIN WP0AA2998


Report

Clear DTCs



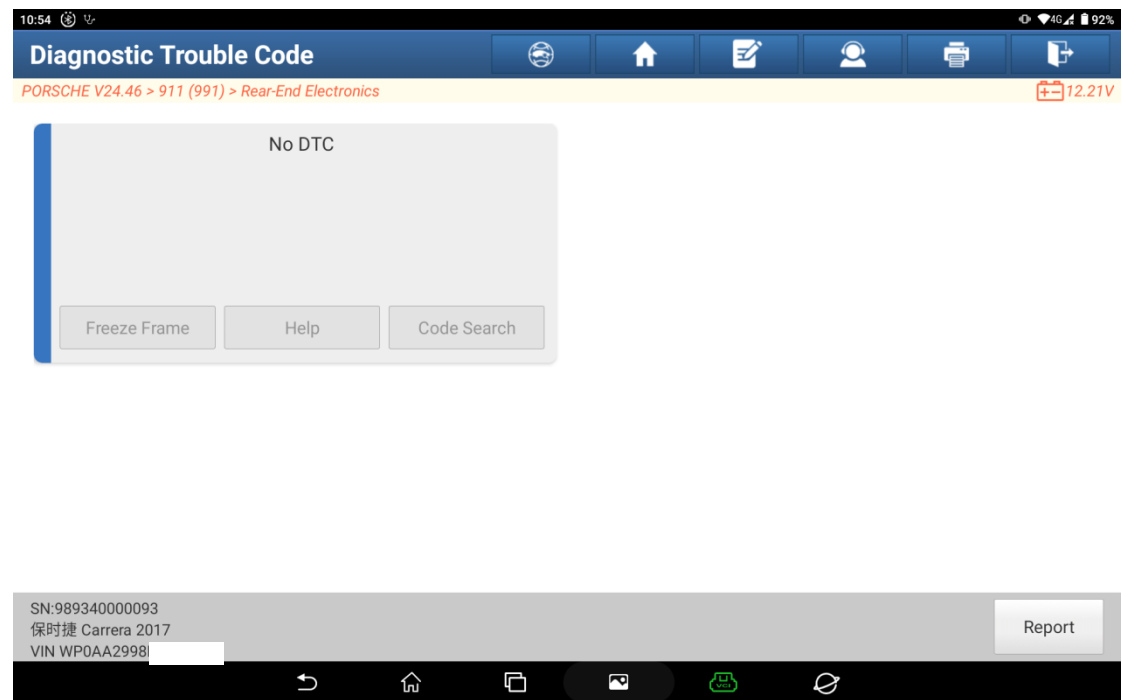

9. Depress spoiler panel button, the spoiler can be stowed, calibration completed.

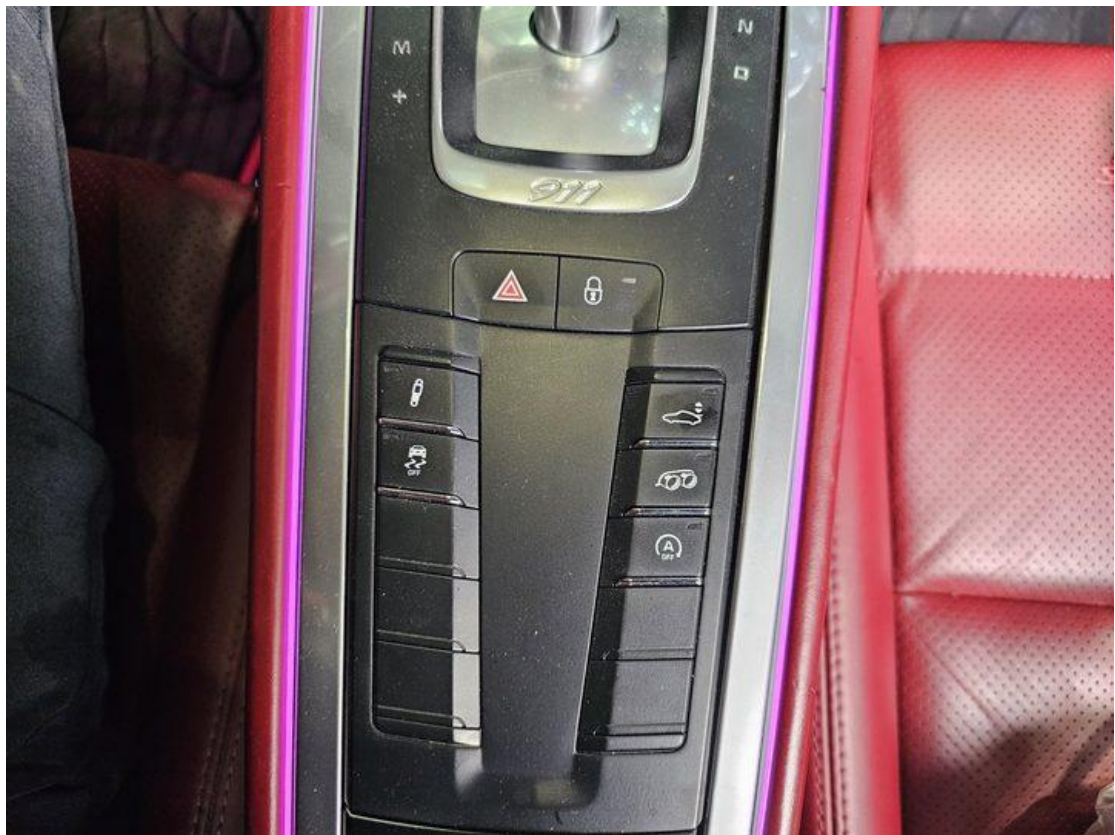



## Statement:

The content of this document is copyrighted by LAUNCH TECH CO., LTD., and no individual or organization may quote or reprint it without consent.