

---

## 2018 Audi A4L Window Regulator Motor Basic Settings

**Actual test model:**

2018 Audi A4L



**Fault description:**

Audi A4L window does not have one-key Regulator function, the fault code is: B148754 window Regulator motor-no basic settings. Use this function to make basic settings.

**Operation guide:**

1) Select "42 door electronics driver side", as shown in Figure 1;



Figure 1

2) Click "OK" to continue, as shown in Figure 2;

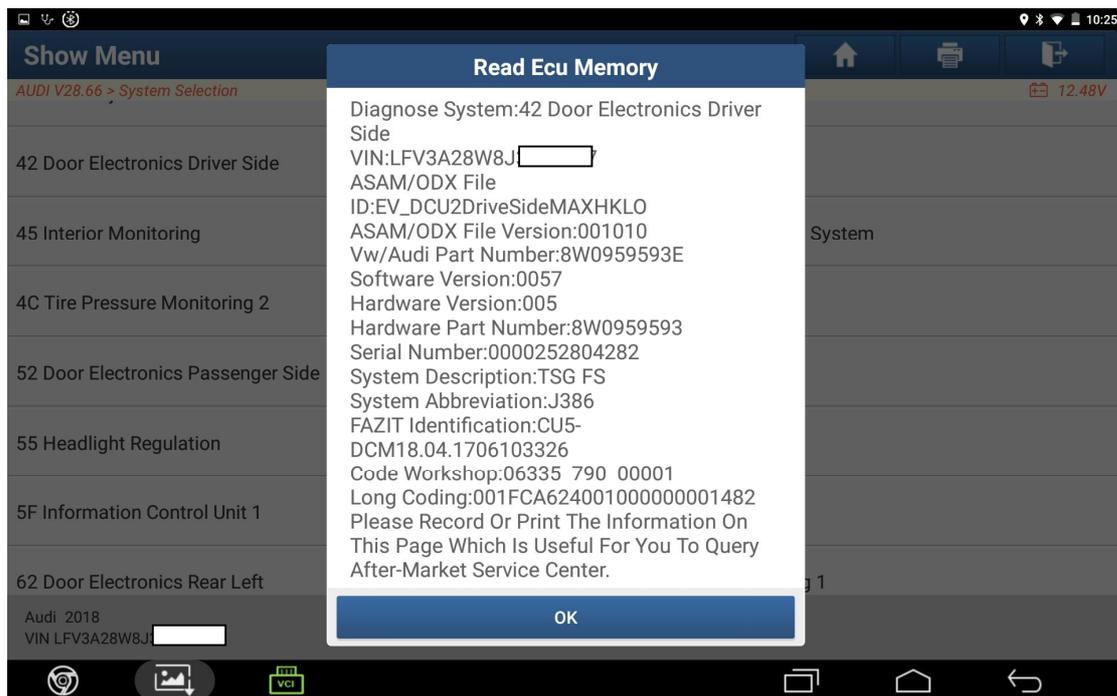


Figure 2

3) Select "02 read DTC", as shown in Figure 3;

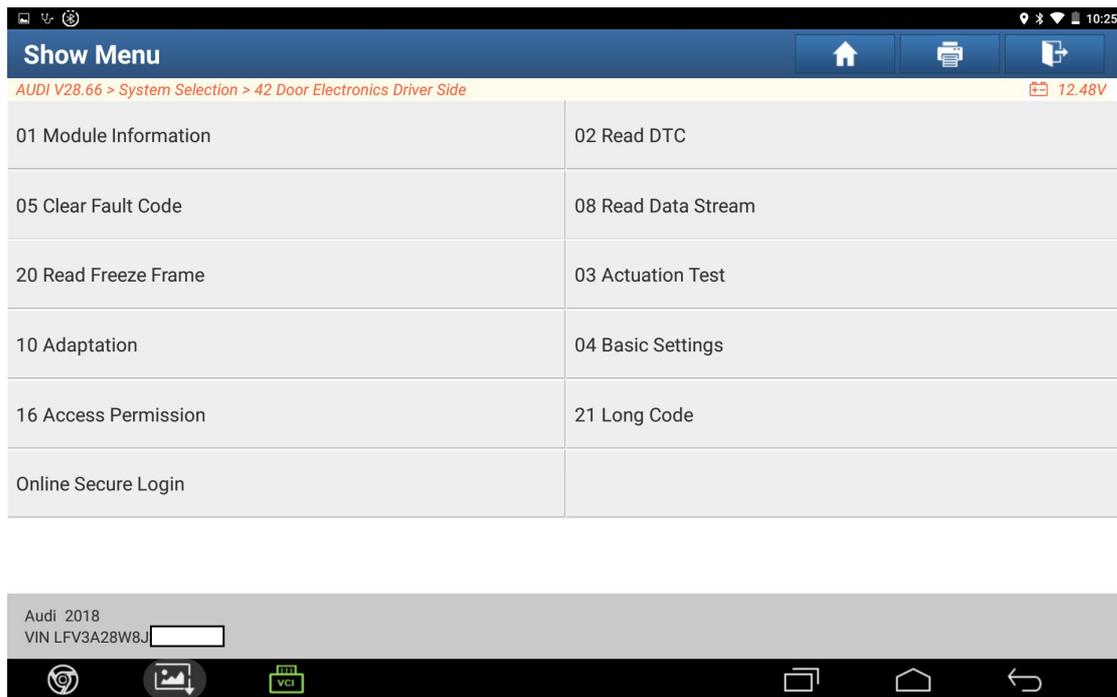


Figure 3

4) The fault code is: B148754 window lift motor-no basic settings, the fault code is active/static, and the fault code cannot be deleted, as shown in Figure 4;

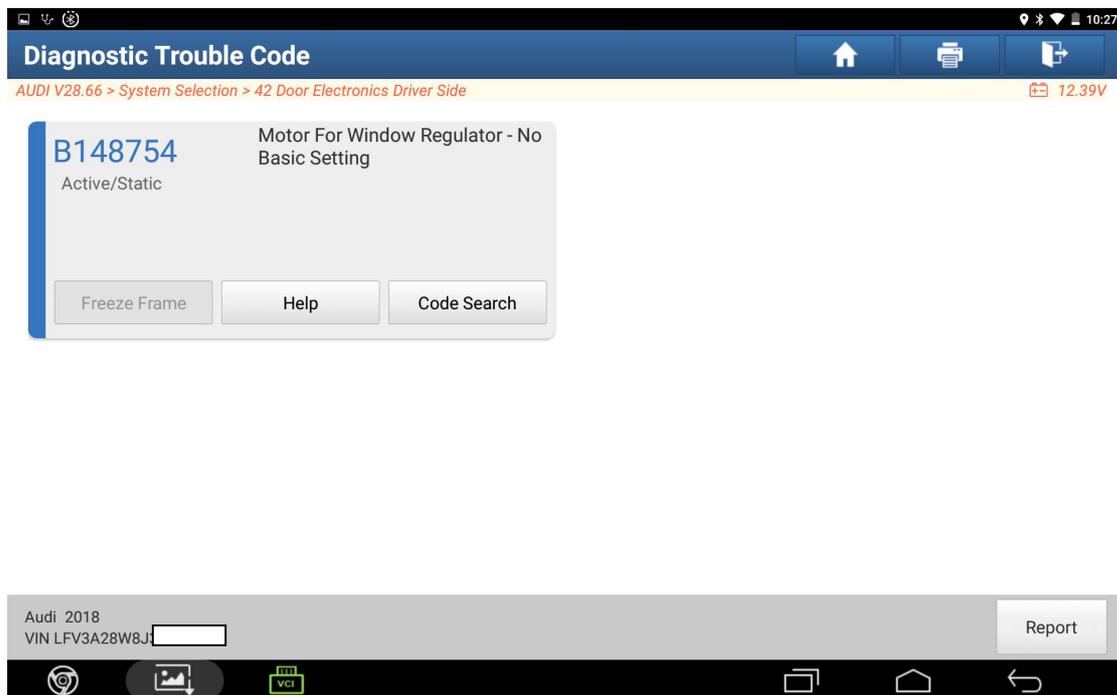


Figure 4

5) Select "04 Basic Settings", as shown in Figure 5;

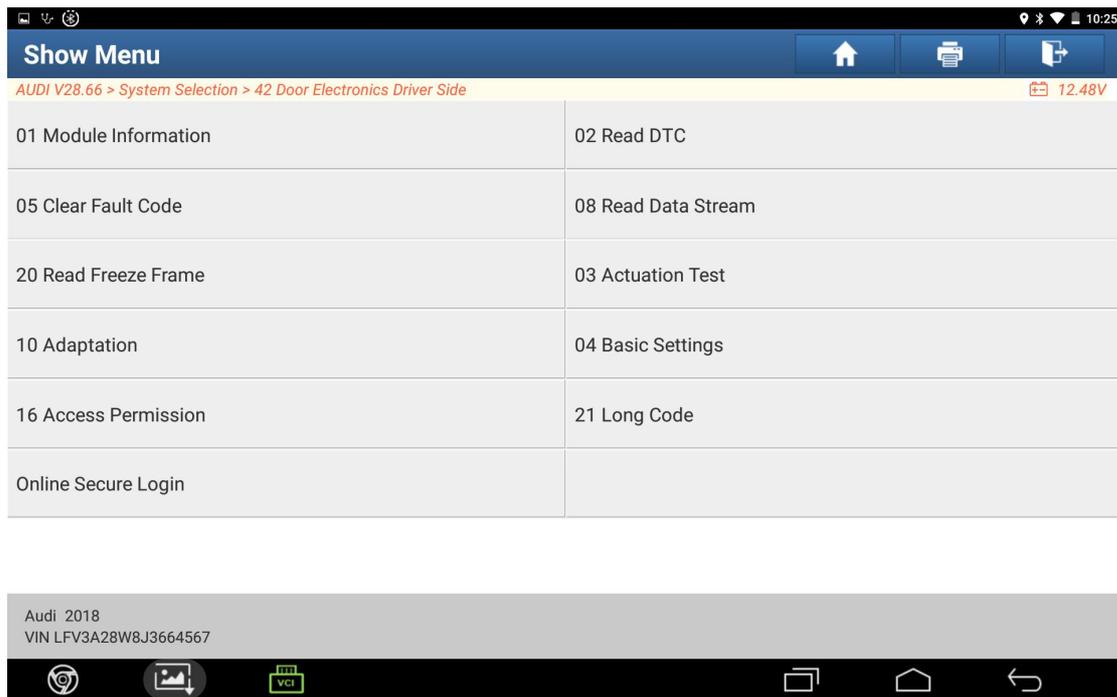


Figure 5

6) Function list, as shown in Figure 6;

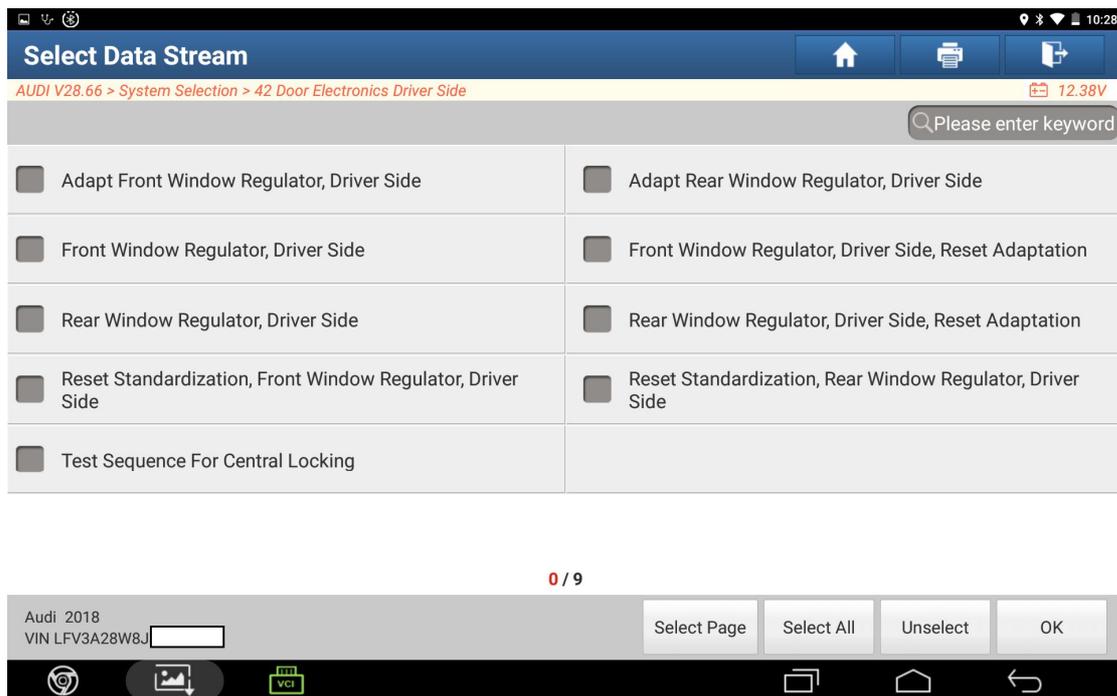


Figure 6

7) Select "Front Window Regulator, Driver Side", as shown in Figure 7;

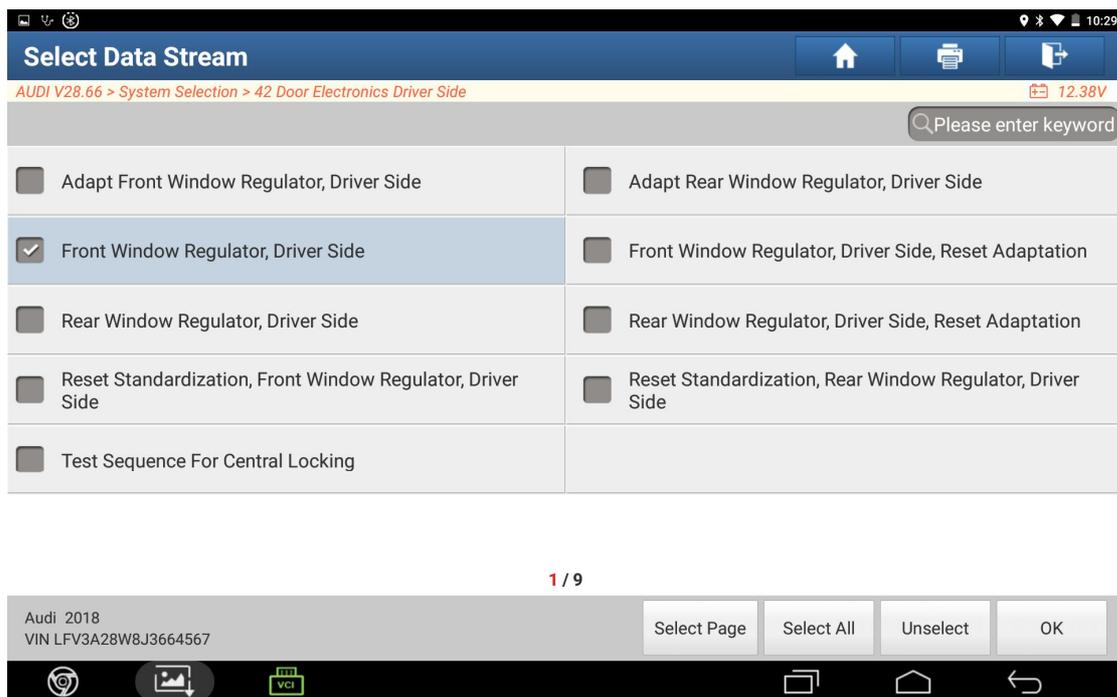


Figure 7

8) Click the "Adjust" button, as shown in Figure 8;

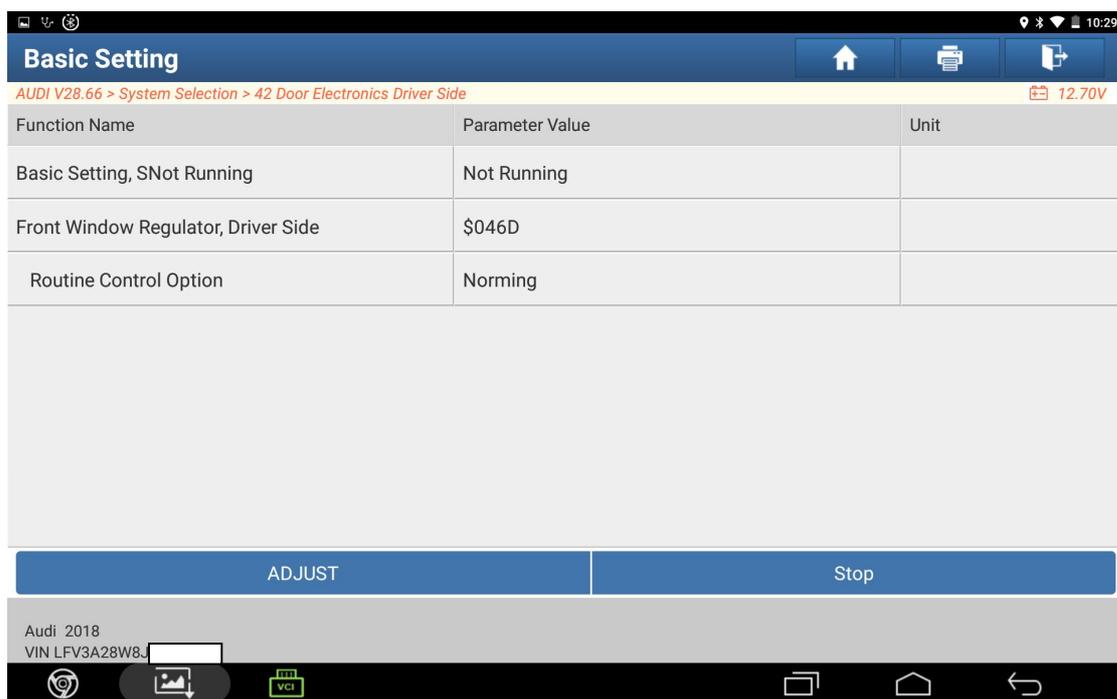


Figure 8

9) Basic settings are running, as shown in Figure 9;

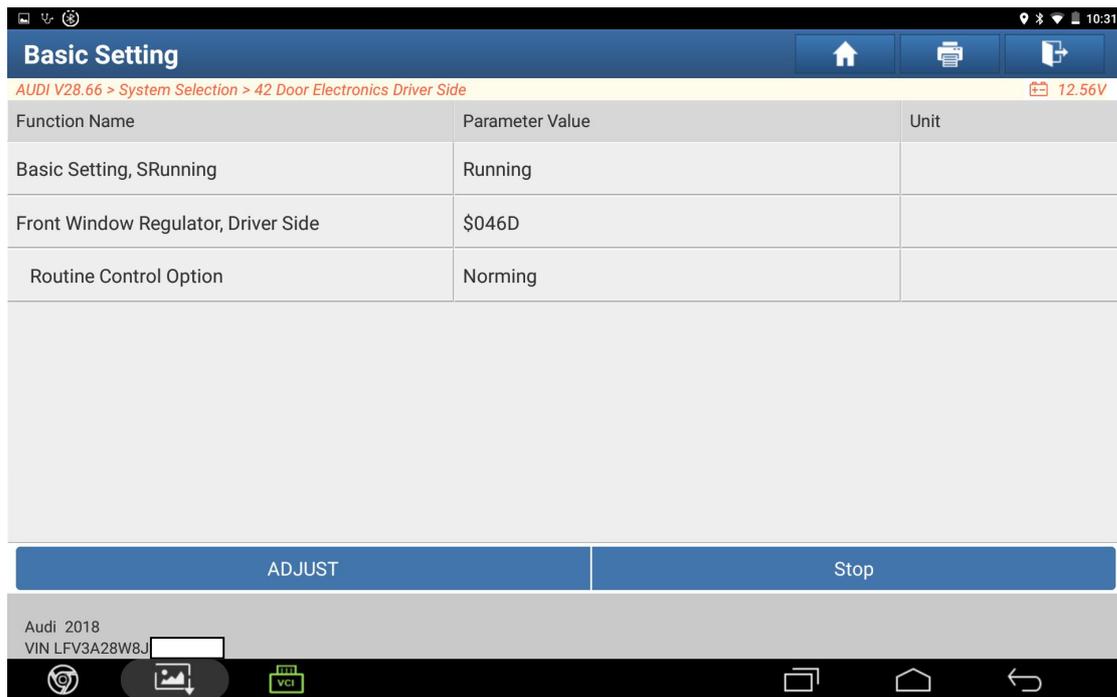


Figure 9

10) The fault code status changes from "active/static" to "passive/Abiogenesis", as shown in Figure 10;

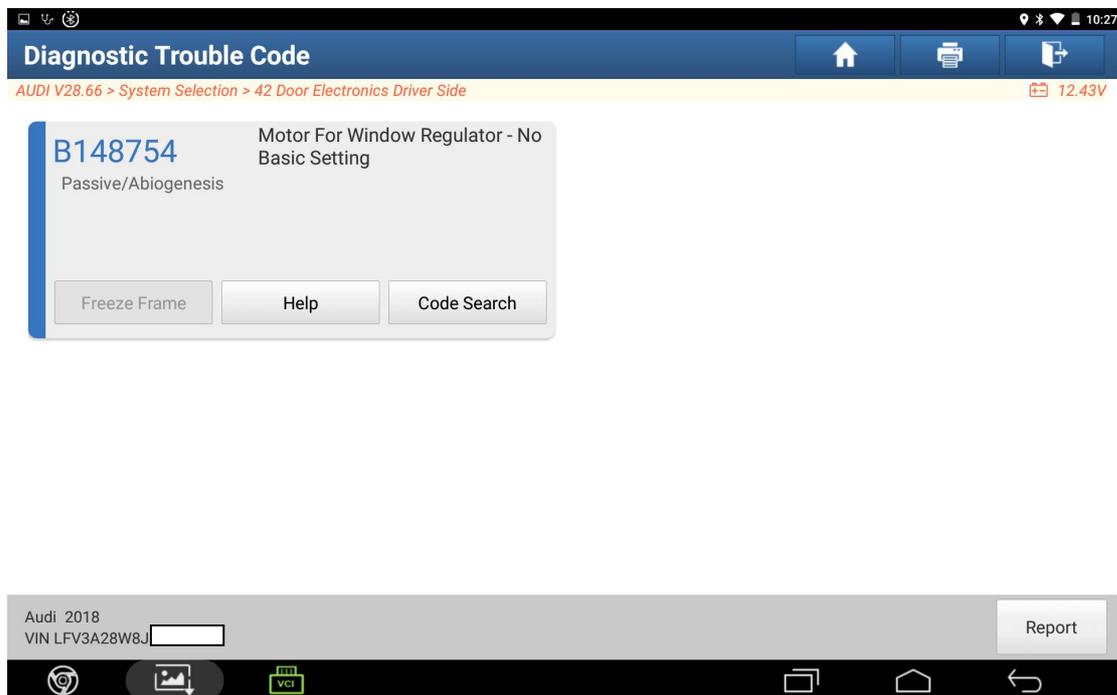


Figure 10

11) Click "Yes" to clear the fault code, as shown in Figure 11;

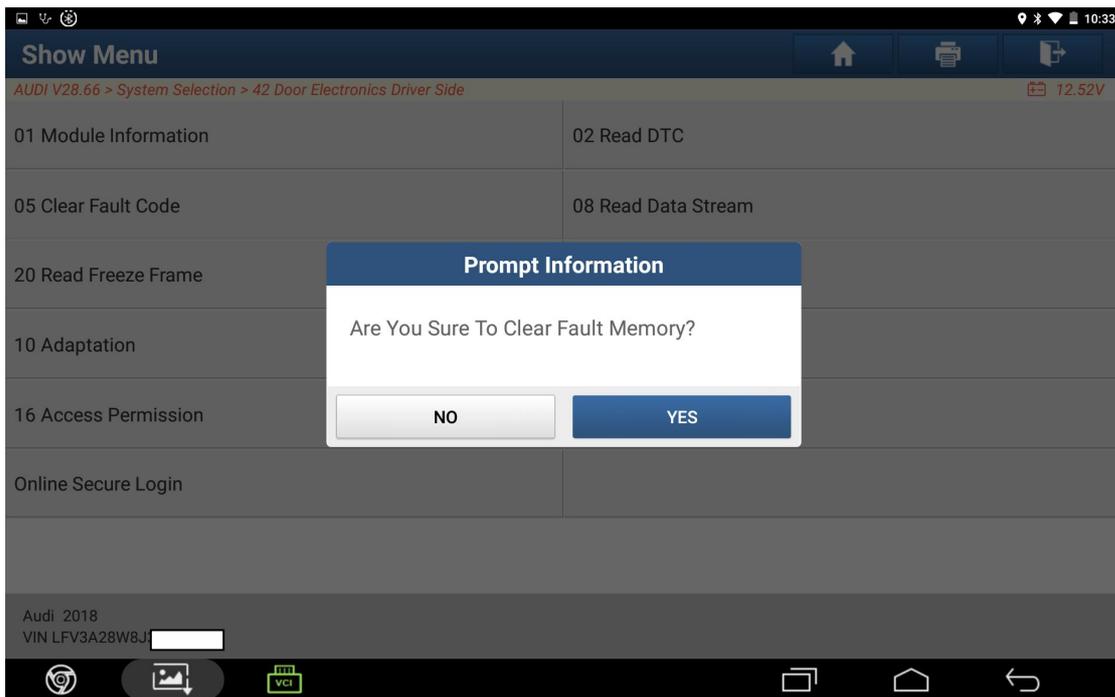


Figure 11

12) Click "Yes" to read DTC again, as shown in Figure 12;

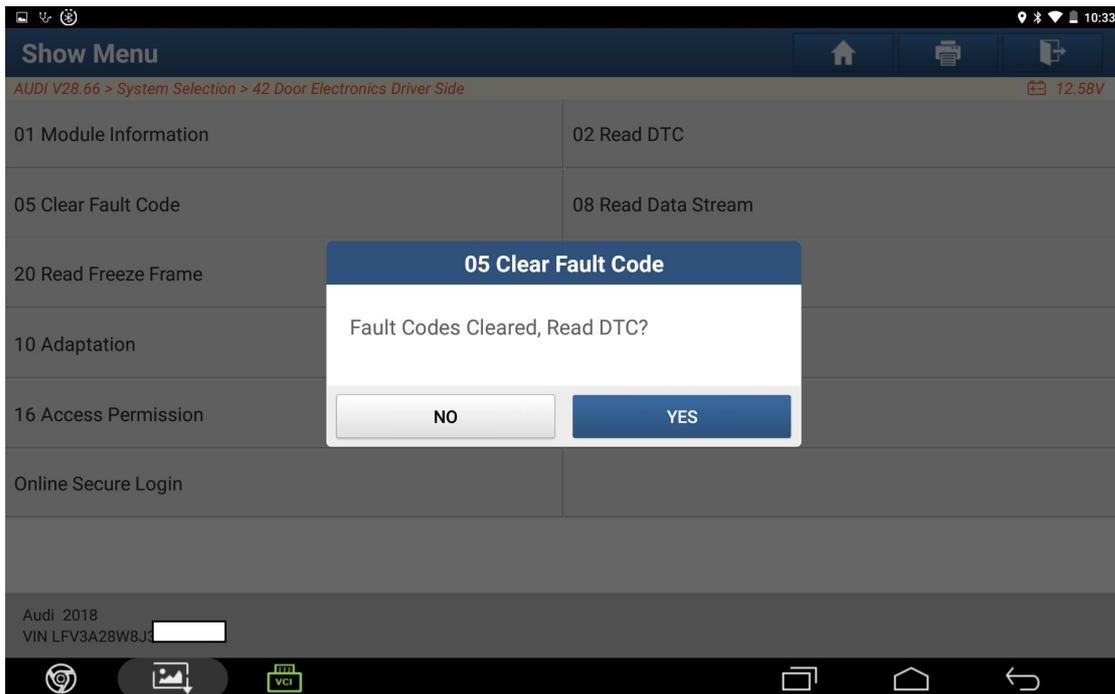


Figure 12

13) There is no fault code in the system, and the window has a key Regulator function, as shown in Figure 13;

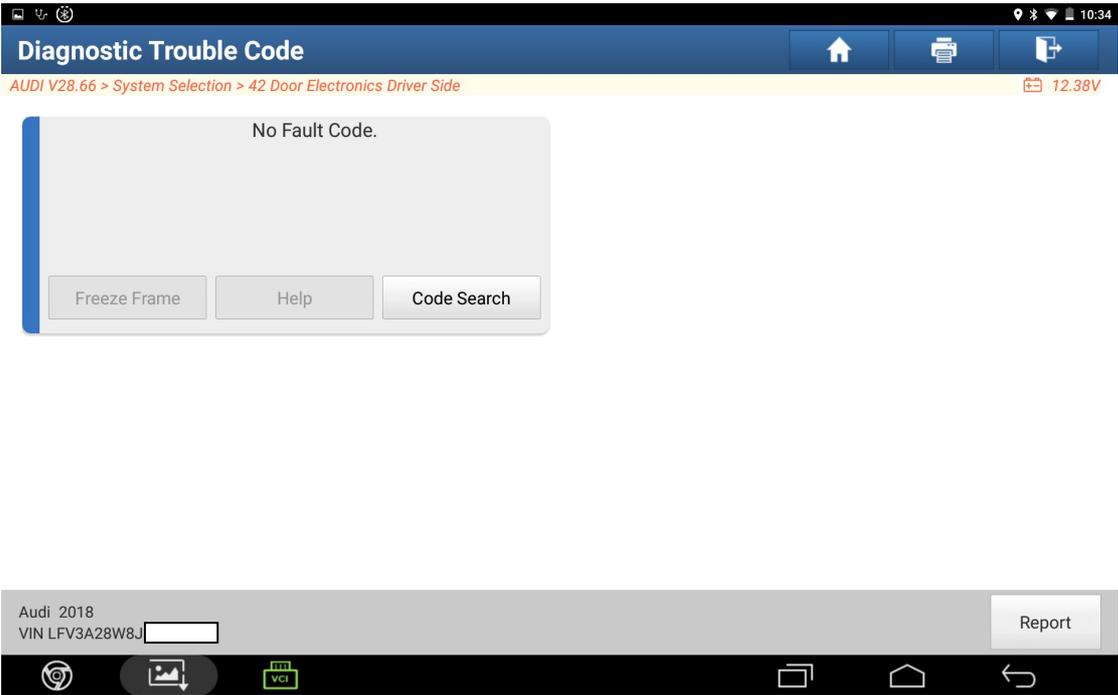


Figure 13;