


LAUNCH

Audi MQB Transmission TCU Unlock Instruction

1. Enter Audi V28.67

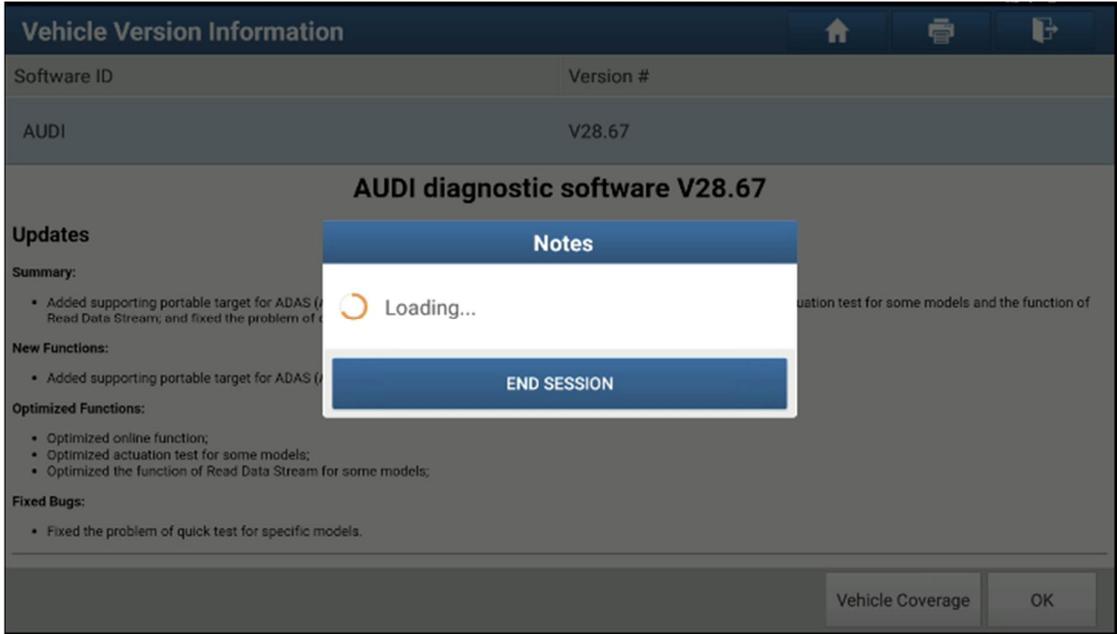

2. Select "Health Report".



LAUNCH

- We can find Fault code P170100-Transmission Control Unit Locked in TCM, Fault code 02229-Transmission Control Module, Immobilizer Data Not Adapted.

Diagnostic Trouble Code

AUDI V28.67 > Health Report 11.74V

U101700 ABS Brake Control Module-Read Out DTC Passive/Abiogenesis

02 Transmission Control Module	3	Enter
P184100 Engine Control Module/Transmission Control Module (TCM) - Versions Not Compatible		Active/Static
P170100 Transmission Control Unit Locked		Active/Static
U010000 Lost Communication With ECM/PCM		Active/Static
03 Brakes 1	12	Enter
U111100 Function Limitation Due To Missing Message		Passive/Abiogenesis
U111100 Function Limitation Due To Missing Message		Passive/Abiogenesis
U111100 Function Limitation Due To Missing Message		Passive/Abiogenesis

Audi 2012
VIN WAUZZ

Report Help Compare Results Clear DTCs

Diagnostic Trouble Code

AUDI V28.67 > Health Report 11.74V

U111200 Function Limitation Due To Implausible Message Passive/Abiogenesis

U111200 Function Limitation Due To Implausible Message Active/Static

U101400 Control Module Incorrectly Coded Active/Static


05 Kessy	2	Enter
01330 Comfort System Central Control Module		Check DTC Memory
02229 Transmission Control Module, Immobilizer Data Not Adapted		
08 Air Conditioning	3	Enter
U111100 Function Limitation Due To Missing Message		Passive/Abiogenesis
U111100 Function Limitation Due To Missing Message		Active/Static
U111100 Function Limitation Due To Missing Message		Passive/Abiogenesis

Audi 2012
VIN WAUZZ


Report Help Compare Results Clear DTCs

LAUNCH

4. Enter Special Function of Audi

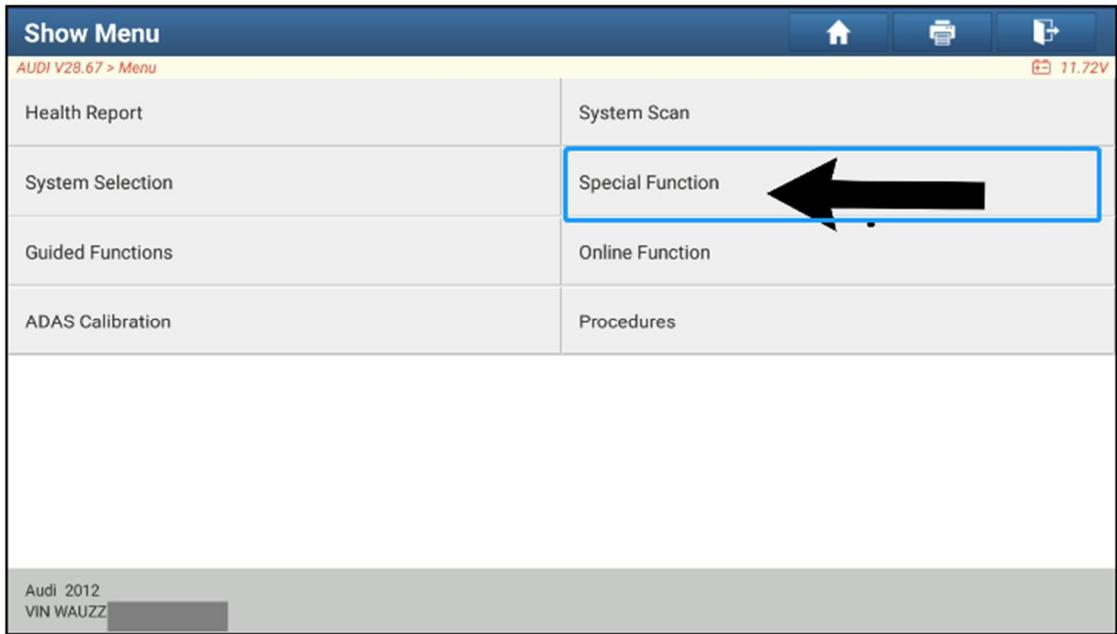


5. Select Anti-theft Function.

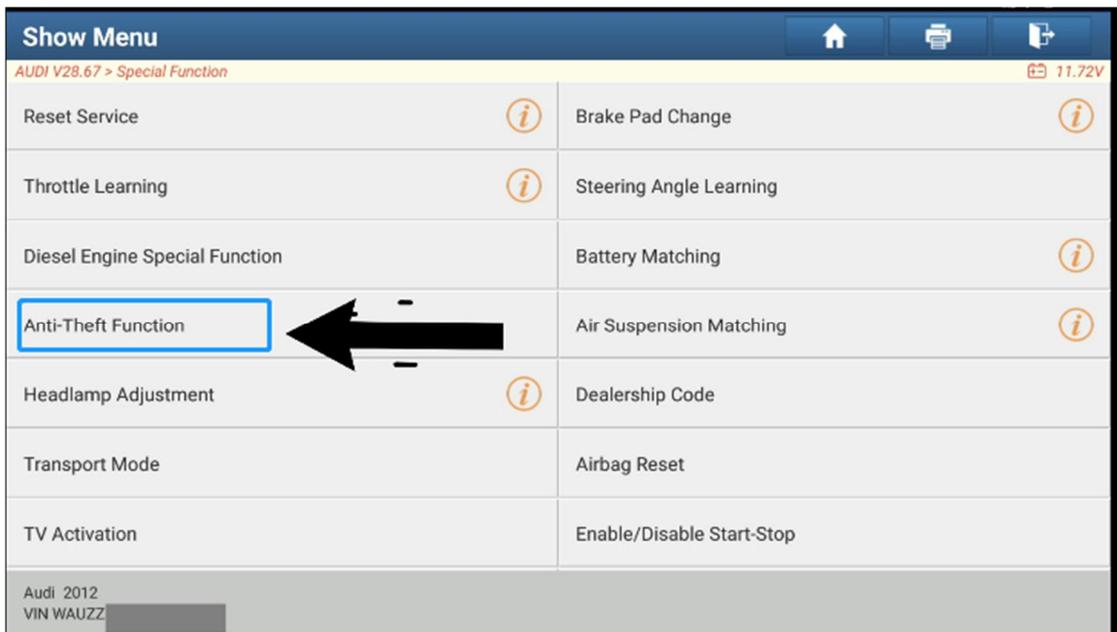


LAUNCH

6. Select 5th Immobilizer.

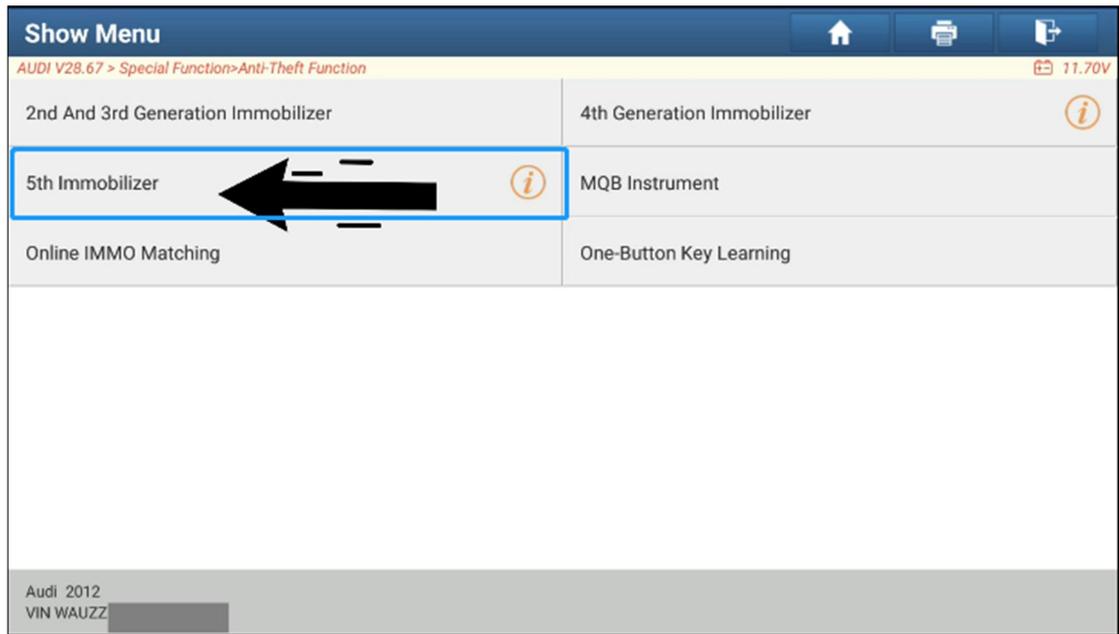


7. Connect vehicle, diagnostic tool and X-PRO G as diagram.

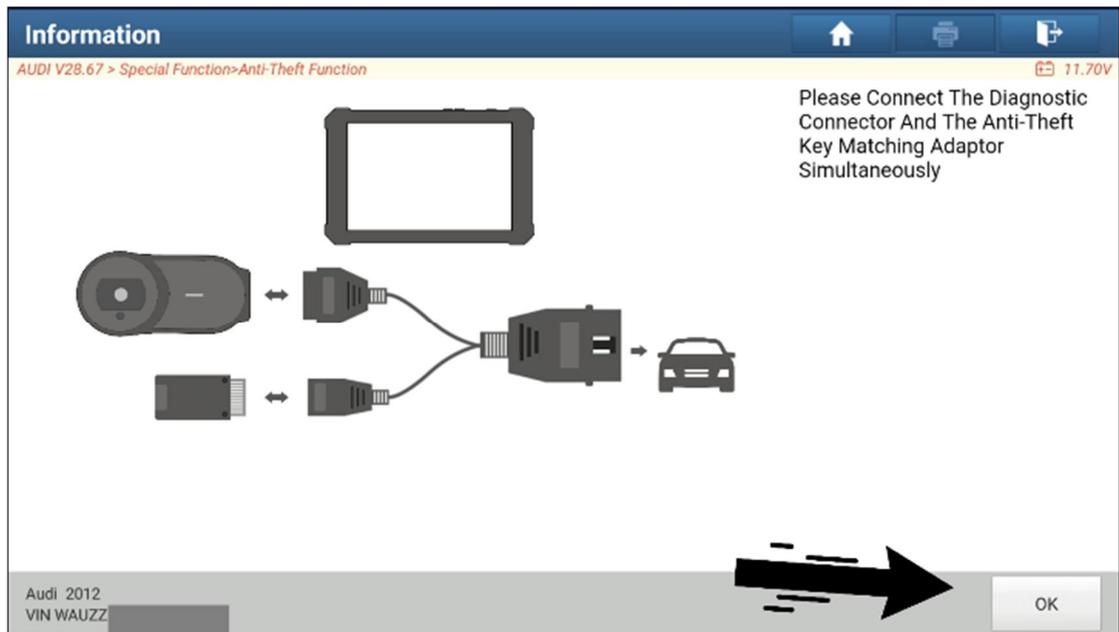


LAUNCH

8. Select 5th Generation Replacement.

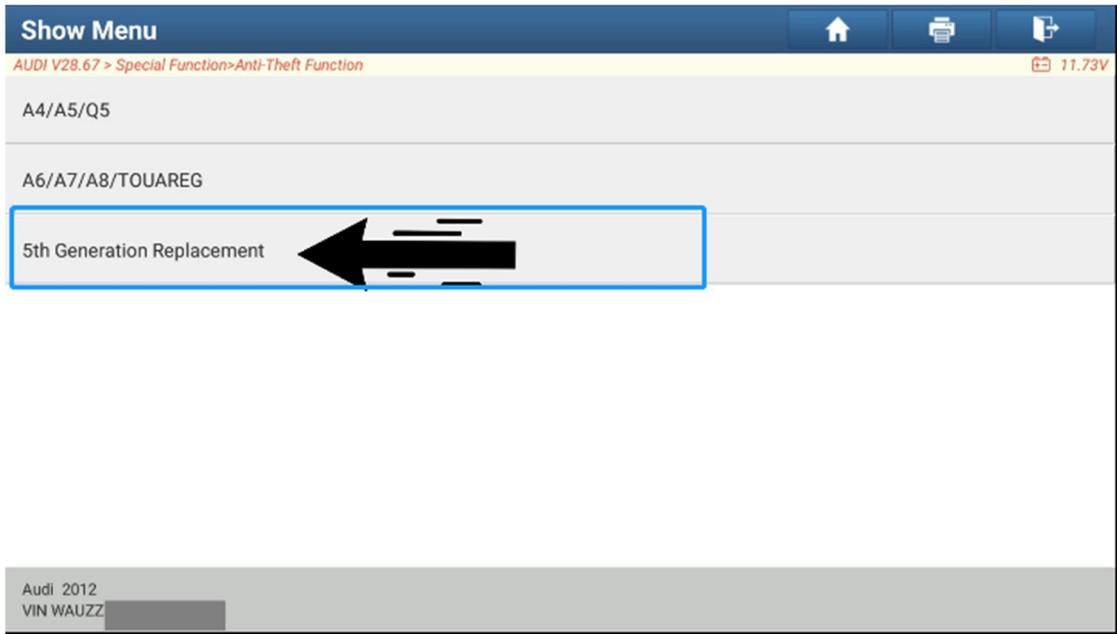


9. Select 5th Generation Transmission

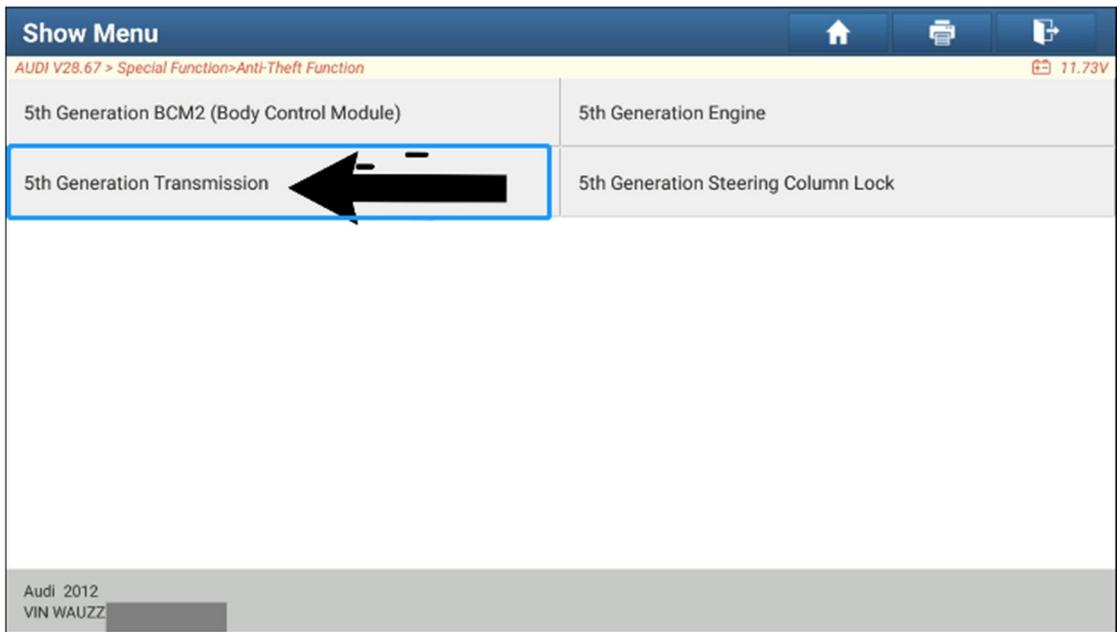


LAUNCH

10. Install the new vehicle ECU on target vehicle, click Ok to continue.

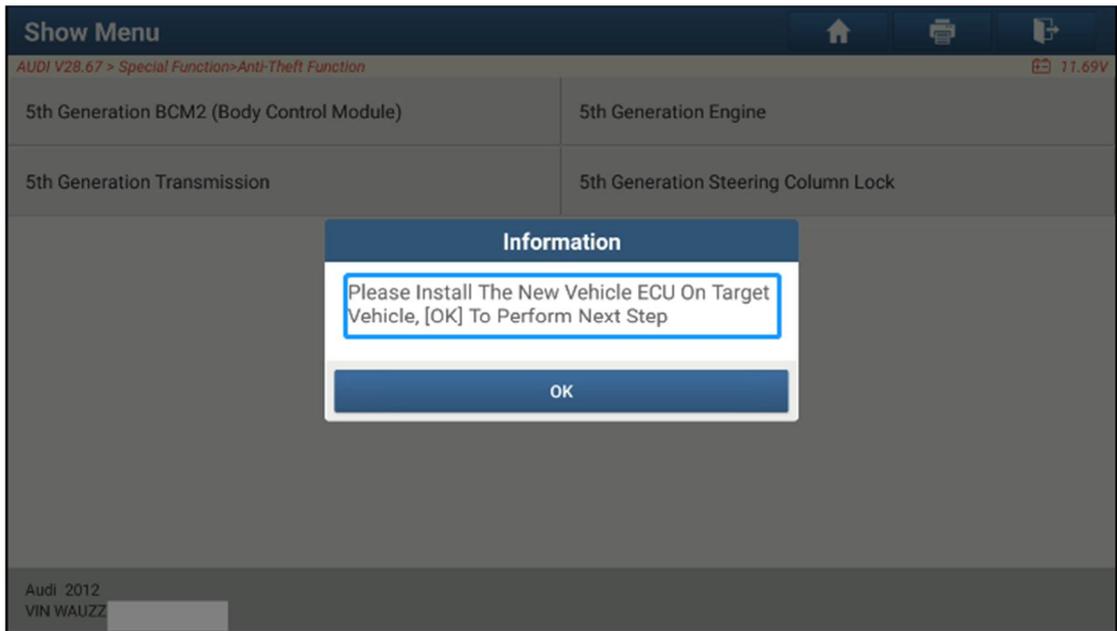

11. Replace succeed.

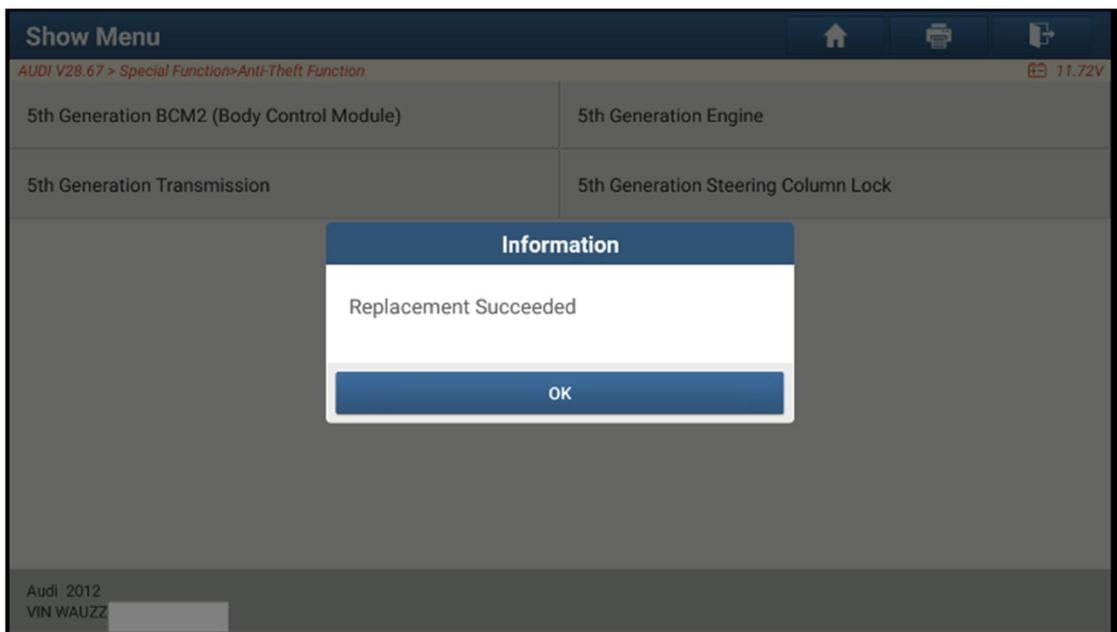

LAUNCH

12. Exit and clear fault code of TCM, and Read DTC. P170100 Missing, Transmission is unlocked.

The screenshot displays a diagnostic software interface with a blue header bar containing the text "Diagnostic Trouble Code" and navigation icons. Below the header, a yellow status bar shows "AUDI V28.67 > Health Report > 02 Transmission Control Module" and a battery icon with "10.76V".

Two diagnostic trouble code (DTC) cards are visible:

- P184100** (Active/Static): Engine Control Module/ Transmission Control Module (TCM) - Versions Not Compatible. Buttons: Freeze Frame, Help, Code Search.
- U010000** (Active/Static): Lost Communication With ECM/ PCM. Buttons: Freeze Frame, Help, Code Search.

At the bottom, a grey bar contains the text "Audi 2012" and "VIN WAUZZ" followed by a redacted area, and a "Report" button on the right.