


Wuling Binguo ABS Online Configuration Function

Function Description: Use this function to configure and match after replacing the ABS.


Tested Model: 2023 Wuling Binguo, VIN: LK6A*****

Fault Description: The DTC [C121208, Configuration Code Error] is read out, as shown in Figure 1.

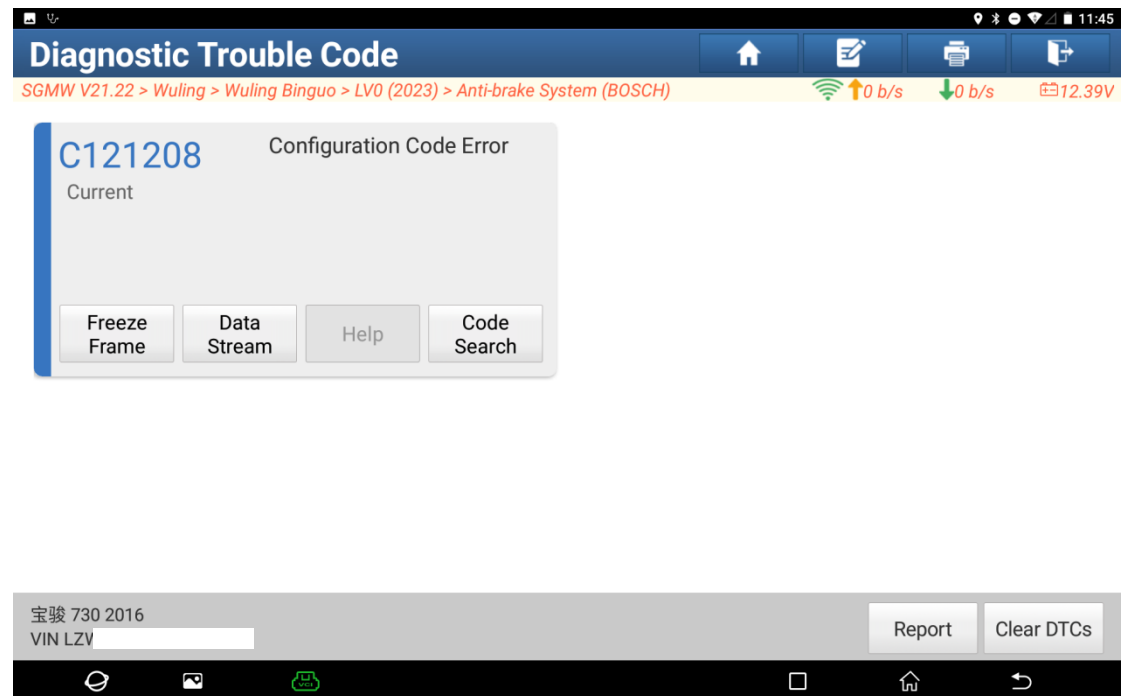


Procedure:

1. Choose [ABS_BS] or [Anti-brake System (BOSCH)].

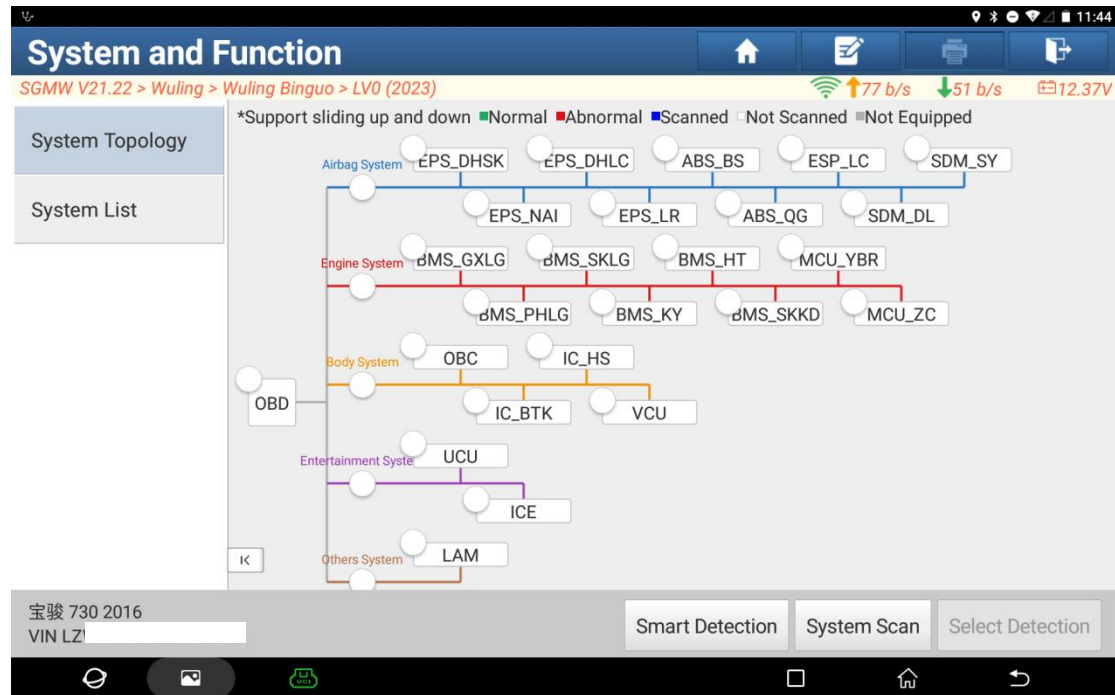

System Name	Status	Action
<input type="checkbox"/> OBD		
<input type="checkbox"/> Electronic Power Steering System (Longrun)	Not Scanned	Enter
<input type="checkbox"/> Anti-brake System (BOSCH)	Not Scanned	Enter
<input type="checkbox"/> Anti-brake System(Qiangu)	Not Scanned	Enter
<input type="checkbox"/> Anti-brake System(United Electronics)	Not Scanned	Enter
<input type="checkbox"/> Instrument Control System (Baotaike)	Not Scanned	Enter
<input type="checkbox"/> Instrument Control System (Hangsheng)	Not Scanned	Enter


2. Choose [Special function]. (See the following figure.)

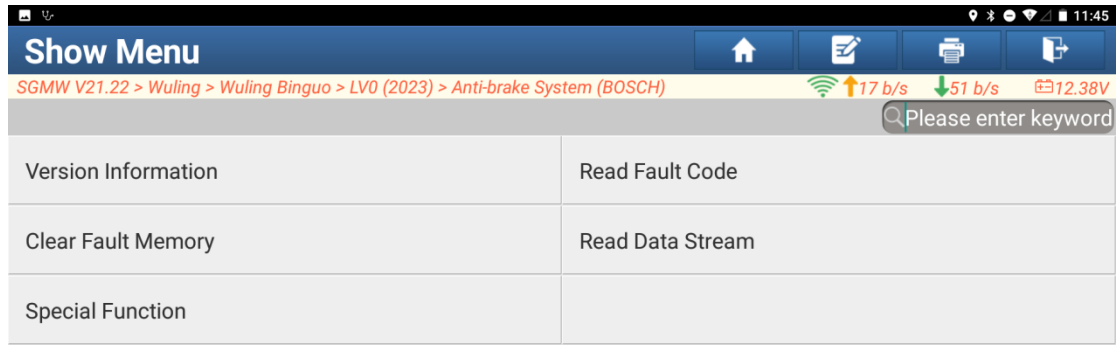


3. Choose [ABS Online Configuration]. (See the following figure.)




4. After confirming the execution conditions, click OK. (See the following figure.)

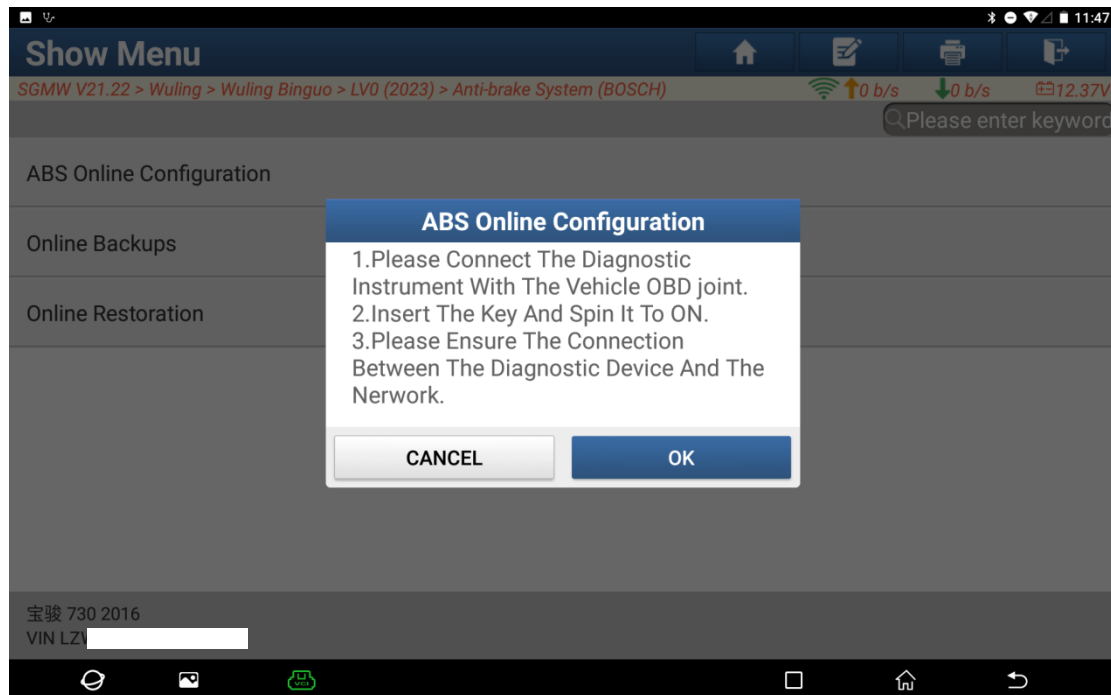


5. After confirming the VIN, click [YES]. (See the following figure.)

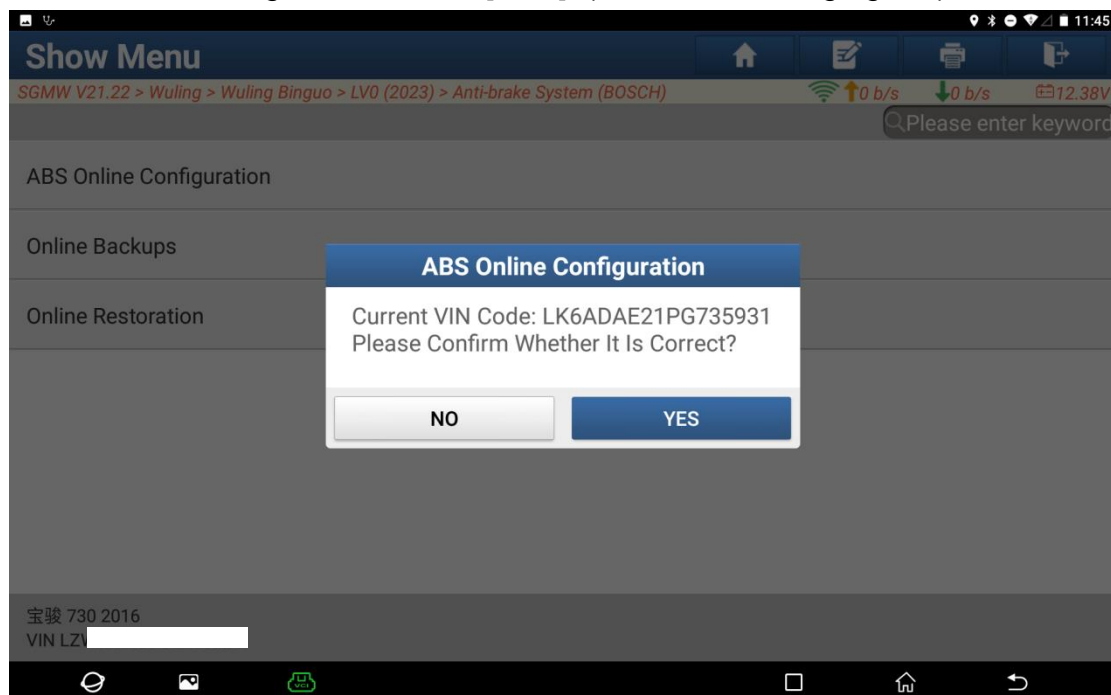

6. Function execution is successful. (See the following figure.)

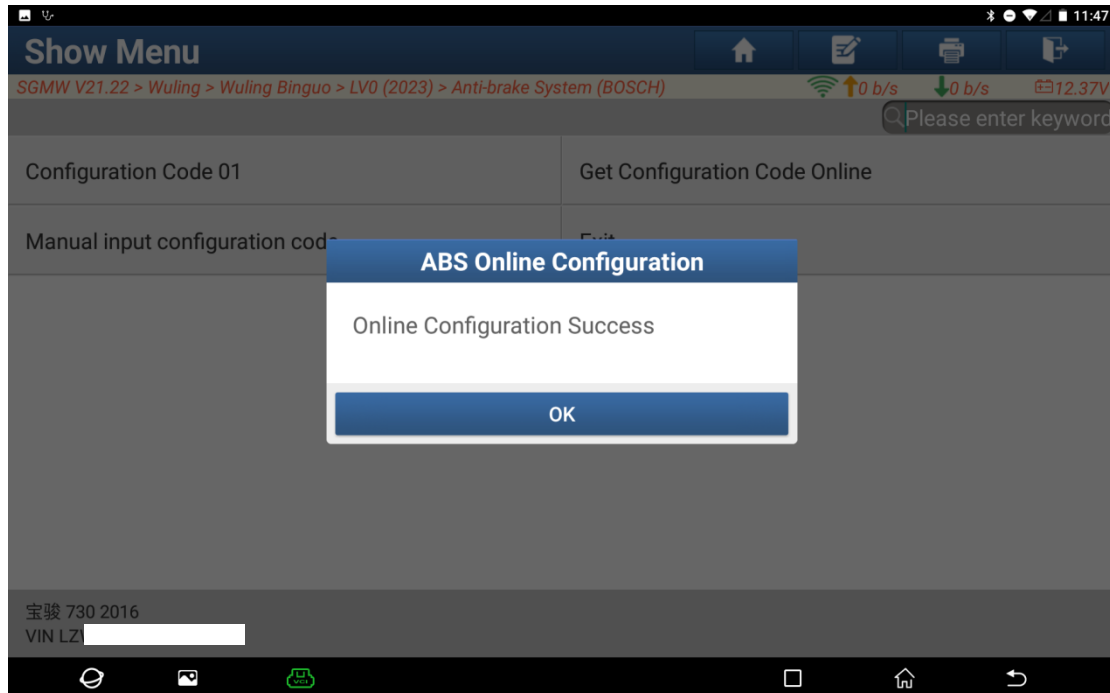

7. Choose [Read DTCs] to read DTCs. The DTC [C121208, Configuration Code Error] has disappeared. (See the following figure.)

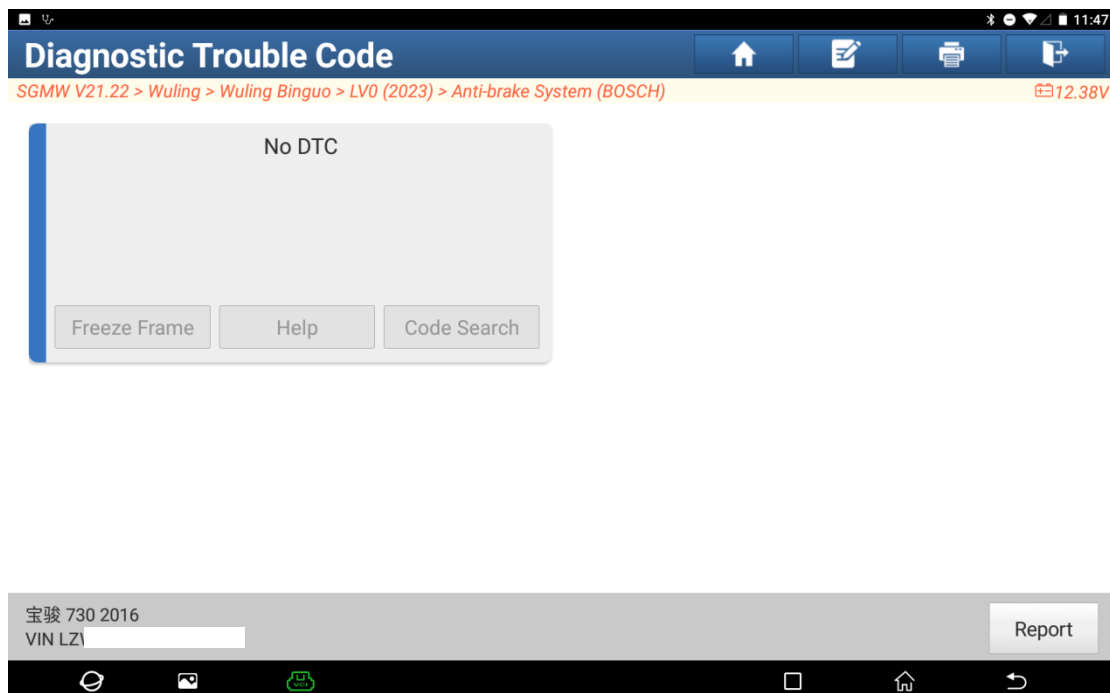

Statement:

The content of this document is copyrighted by Shenzhen Launch Tech Co., Ltd., and no individual or organization may quote or reprint it without consent.